

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"শ্রমজীবী মানুষের অধিকার, বৈৰম্যাহীন বাংলাদেশের অঙ্গীকার"

ক্যাপ পর্ববেষ্ফণের তথ্য

	কালাৰ স্টীচ লিঃ
ঠিকানা	119, Ashkona Medical Road,
কারখানার কোড	DHK 132
কালার কোড	

মুল্যারনের ধরণ: বৈঘুতিক মুল্যারন	পর্যবেষ্ফণের তারিখ: ০২–০৪–২০২৩
১. পর্যবেষ্ণ	

পরিদর্শন পর্ববেষ্ণ্ডণ	☐ Transformer room walls less than 4hr fire resistance ☐ Door having fire resistance rating less than 2hr ☐ No separating wall between Switchgears and Transformer ☐ Poor illumination in transformer room ☐ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

. २. मा मक्	
	Produce design drawings to demonstrate the incorporation of fire rated enclosure
 কাৰ্যক্ৰম	from floor to ceiling and an approved fire rated self-closing swing door for the
1111421	Transformer room. Provide firefighting equipment as required by the Guidelines.
সুপারিশের	
<u>ভ</u> িখ্যসূত্র	
	We have not taken any action but we will take action and complete within this
কাৰ্যক্ৰম	timeline.
<u>অগ্রা</u> ধিকার	৬ সপ্তাহ
চুডান্ত সমশ্রসীমা	79-04-5074
সংশোধিত	02-02-2290
সমশ্রসীমা	02-02-2010
<u>অগ্রগতির</u>	চলমান
<u>অবস্থা</u>	
	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline.
	25-06-2020 visit Observation: Transformer room walls are not less than 4hr fire
	resistance. No separating wall between Switchgears and Transformer. Inadequate
	cross ventilation for the transformer room. 08–10–2020: Transformer room walls
	are less than 4hr fire resistance. No separating wall between Switchgears and
	Transformer. Inadequate cross ventilation for the transformer room. 26–01–2021
	on visit day Transformer room walls are not less than 4hr fire resistance. No separating wall between Switchgears and Transformer. Inadequate cross
<u>মন্তব্য</u>	ventilation for the transformer room. 10–06–2021: 1. Design drawings to
	demonstrate the incorporation of fire rated enclosure from floor to ceiling were
	found but no approved fire rated self-closing swing door installed for the
	Transformer room. 2. Fire-fighting equipment were observed in substation room.
	07-08-2022 Visit Observation: 1. Design drawings to demonstrate the
	incorporation of fire rated enclosure from floor to ceiling were found but no
	approved fire rated self-closing swing door installed for the transformer room. 2. Fire-fighting equipment were observed in substation room. 02-04-2023: Same as
	previous visit.

সংখুক্তিসমূহ (২)





পরিদর্শন পর্ববেষ্ফণ	☐ Transformer room walls less than 4hr fire resistance ☐ Door having fire resistance rating less than 2hr ☐ No separating wall between Switchgears and Transformer ☐ Poor illumination in transformer room ☐ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্শক্ৰম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Transformer room. I Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখানার	We have not taken any action but we will take action and complete within this
কাৰ্যক্ৰম	timeline.
<u>অগ্রা</u> ধিকার	৬ মাস
চুডান্ড সময়সীমা	09-25-5089
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্বনি
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Not Install appropriate detectors to Transformer room. 08-10-2020: Not Install appropriate detectors to Transformer room. 26-01-2021 on visit day Not Install appropriate detectors to Transformer room. 10-06-2021: 1. Fire rated enclosure from floor to ceiling were not adequate and an approved fire rated self-closing swing door for the Transformer room were not installed. 2. No appropriate detector observed for the substation room. 07-08-2022 Visit Observation: 1. Fire rated enclosure from floor to ceiling were not adequate and an approved fire rated self-closing swing door for the Transformer room were not installed. 2. No appropriate detector observed for the substation room. 02-04-2023: Same as previous visit.

সংযুক্তিসমূহ (৪)







পরিদর্শন	☐ Transformer room walls less than 4hr fire resistance ☐ Door having fire resistance rating less than 2hr ☐ No separating wall between Switchgears and Transformer ☐ Poor illumination in transformer room ☐ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

<u>কাশ্ৰুম</u>	Ensure illumination and cross ventilation to Transformer
সুপারিশের	
ভখ্যসূত্র	
কারখানার	We have not taken any action but we will take action and complete within this
কাৰ্যক্ৰম	timeline.
<u>অগ্রা</u> খিকার	প্রব্যোগ্য নর
চুডান্ড সমশ্বসীমা	22-09-309
সংশোধিত সমশ্রসীমা	02-02-2290
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. Complete within timeline. 25–06–2020 visit Observation: Not Install illumination and cross ventilation to Transformer 08–10–2020: No illumination and cross ventilation installed to Transformer. 26–01–2021: On visit day No illumination & cross ventilation installed to Transformer. 10–06–2021: Adequate illumination and cross ventilation observed for transformer room. 07–08–2022 Visit Observation: Adequate illumination and cross ventilation observed for transformer room. 02–04–2023: Same as previous visit.

সংযুক্তিসমূহ (৪)







পরিদর্শন | Inadequate ventilation of the generator room | The generator room is not properly segregated from the rest of the occupancy | One point frame earthing of generator instead of two | No cover on the cable trench

ক্যাপ আই্টেস্ ক্যাটাগরি

৪.১. কাৰ্যক্ৰম

0.00 11 1971		
L	কাৰ্যক্ৰম	Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room.
	মুপারিশের তথ্যসূত্র	
7		We have not taken any action but we will take action and complete within this timeline.
	<u> </u>	
Ī	ূড়ান্ত শমশ্বসীমা	29-04-507d
-	মংশোধিত মন্ম <u>সী</u> মা	07-07-790
	মগ্রগতির মবস্থা	চলমান
3	নন্ত ব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. 08–10–2020: Exhaust fan is found. Generator room have adequate cross ventilation. Body earthing of generator are found at two points. The generator room is segregated from the rest of the occupancy. They are providing cable trench at generator room. 26–01–2021: On visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy . Found two point frame earthing of generator. 10–06–2021: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was found but approved fire rated self–closing swing door for the generator room was observed. 07–08–2022 Visit Observation: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was found but approved fire rated enclosure from floor to ceiling was found but approved fire rated self–closing swing door for the generator room was not installed. 2. Inadequate ventilation of the generator room was not installed. 2. Inadequate ventilation of the generator room was observed. 02–04–2023: Same as previous visit.

সংখুক্তিসমূহ (২)





প	রিদ	ৰ্শন	
প	ৰ্থ<ে	ক্ষ	ĺ

Inadequate ventilation of the generator room \square The generator room is not properly segregated from the rest of the occupancy \square One point frame earthing of generator instead of two \square No cover on the cable trench

ক্যাপ আইটেম ক্যাটাগরি

৫.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room .
সুপারিশের তথ্যসূত্র	
কার্থানার কার্বক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	৬ মাস
চুডান্ড সমশ্রসীমা	09-52-2059
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্ৰানি
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: 08-10-2020: No fire door was found for generator room. 26-01-2021 on visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy . Found two point frame earthing of generator. 10-06-2021: 1. The generator room is not properly segregated with fire rated wall and self swing fire rated door from the rest of the occupancy. 2. Inadequate ventilation of the generator room. 07-08-2022 Visit Observation: 1. The generator room is not properly segregated with fire rated wall and self swing fire rated door from the rest of the occupancy 2. Inadequate ventilation of the generator room. 02-04-2023: Same as previous visit.

সংসুক্তিসমূহ (৪)







পরিদর্শন | Inadequate ventilation of the generator room | The generator room is not properly segregated from the rest of the occupancy | One point frame earthing of generator instead of two | No cover on the cable trench

ক্যাপ আই্টেস্ ক্যাটাগরি

৬.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Provide cover on the cable trench Ensure double earthing of generator frame.		
সুপারিশের			
ভখ্যসূত্র			
1 1	We have not taken any action but we will take action and complete within this		
কাৰ্যক্ৰম	timeline.		
—	ৰ্ প্ৰযোগ্য নয়		
চুডান্ড সময়সীমা	22-04-5024		
সংশোধিত সময়সীমা			
অগ্রগতির	F30161		
অবস্থা	চলমান		
মন্ত ব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25–06–2020 visit Observation: One point earthing of generator frame. Not cover on the cable trench. 08–10–2020: Body earthing of generator are found at two points. They are providing cable trench at generator room. 26–01–2021: On visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy .Found two point frame earthing of generator. 26–01–2021 on visit day Body earthing of generator are found at two points. 10–06–2021: 1. Cable trenches were not covered properly. 2. Double earthing observed at generator body frame. 07–08–2022 Visit Observation: 1. Cable trench were not covered properly. 2. Double earthing were observed at generator body frame. 02–04–2023: Same as previous visit.		

সংখুক্তিসমূহ (৪)







পরিদর্শন পর্ববেষ্ডণ ☐ Ventilation and illumination of substation is poor ☐ Separating wall not extended up to the ceiling ☐ No clear identification mark on distribution panel ☐ No instruction for first aid to electrical shock and artificial respiration ☐Non-conductor mat not provided

ক্যাপ আইটেম ক্যাটাগরি

৭.১. কাৰ্যক্ৰম

	Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the
	Substation room. Provide clear identification mark on distribution panel.
ਸ਼ੁਆਰਿਆਰ	

সুপারিশের তথ্যসূত্র

কার্থানার We have already started work on this issue and supposed to be complete within কাৰ্যক্ষ timeline

অগ্রাধিকার ৬ সপ্তাহ

চুড়ান্ত সময়সীমা

22-01-5021

সংশোধিত সমর্মীমা

02-02-2290

অগ্রগতির অবস্থা

মন্তব্য

চলমাল

Previous Timeline: N/A. had no CAP Report Final Timeline: 11-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: No clear identification mark on distribution panel. Nonconductor mat not provided 08-10-2020: Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. Clear identification mark on distribution panel was found. No instruction for first aid to electrical shock and artificial respiration. Conductor mat are provided in front of DB boards. 26-01-2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. Clear identification mark on distribution panel was found. No instruction for first aid to electrical shock and artificial respiration. Conductor mat are provided in front of DB boards. 10-06-2021: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was produced and fire rated self-closing swing door for the Substation room was not approved yet. 2. Clear identification mark observed on distribution boards. 07-08-2022 Visit Observation: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling were produced and fire rated self-closing swing door for the Substation room were not approved yet. 2. Clear identification mark were observed on distribution boards. 02-04-2023: Same as previous visit.

সংখক্তিসমূহ (৪)









পরিদর্শন পর্ববেষ্ফণ	Uventilation and illumination of substation is poor \square Separating wall not extended up to the ceiling \square No clear identification mark on distribution panel \square No instruction for first aid to electrical shock and artificial respiration \square Non-conductor mat not provided
ক্যাপ আইটেম ক্যাটাগরি	

৮.১. কাৰ্যক্ৰম		
কাৰ্যক্ৰম	☐ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Substation room. ☐ Install appropriate detectors	
সুপারিশের তখ্যসূত্র		
কার্থানার কার্বক্রম	timeline.	
<u>অগ্রা</u> খিকার	্ডি মাস	
চুডান্ত সময়সীমা	09-22-2029	
সংশোধিত সময়সীমা	07-07-7940	
অগ্রগতির অবস্থা	শুৰু হ্ৰাণি	
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Not Install appropriate detectors to Substation room. 08-10-2020: Did not install appropriate detectors to Substation room. 26-01-2021: On visit day Did not install appropriate detectors to Substation room. 10-06-2021: 1. Substation room was not segregated from the rest of the occupancy with fire rated wall and self swing fire rated door. 2. Appropriate detector was not found for the substation room. 07-08-2022 Visit Observation: 1. Substation room were not segregated from the rest of the occupancy with fire rated wall and self swing fire rated door. 2. Appropriate detector were not found for the substation room. 02-04-2023: Same as previous visit.	

সংযুক্তিসমূহ (২)





প	রিদ	ৰ্শন	Γ
প	ৰ্থ<ে	12%	ণ

 \square Ventilation and illumination of substation is poor \square Separating wall not extended up to the ceiling \square No clear identification mark on distribution panel \square No instruction for first aid to electrical shock and artificial respiration \square Non-conductor mat not provided

ক্যাপ আইটেম ক্যাটাগরি

৯.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Ensure ventilation and illumination to substation Provide instructions for first aid and artificial respiration from exposure to electrical shock. Provide rubber mat in front of the panel
সুপারিশের তখ্যসূত্র	
কারখানার কার্বক্রম	We have not taken any action but we will take action and complete within this timeline.
<u>অগ্রা</u> খিকার	প্রযোগ্য নর
চুডান্ড সমশ্রসীমা	\$\$-09-20\$9
সংশোধিত সমশ্বসীমা	07-07-790
অগ্রগতির অবস্থা	চলমাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25–06–2020 visit Observation: Non–conductor mat not provided. 08–10–2020: Provided rubber mat in front of the panel. 26–01–2021 on visit day rubber mats are kept in front of distribution boards. 10–06–2021: 1. Adequate illumination and ventilation observed for substation room. 2. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 3. Insulated rubber mat was not provided in front of some panels for e.g. HT panel. 07–08–2022 Visit Observation: 1. Adequate illumination and ventilation observed for substation room. 2. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 3. Insulated rubber mat was not provided in front of some panels for e.g. HT panel. 02–04–2023: Same as previous visit.

সংখুক্তিসমূহ (৪)







 \parallel No instruction for first aid to electrical shock \parallel Cable ends not properly soldered or crimped \parallel Visible burn marks \parallel Connection without lug \parallel Undressed messy wire inside \parallel Body & door not পর্শবেক্ষণ earthed 🛘 No clear identification mark on distribution board 🖟 MDB/SDB/SB or MCB installed on the wooden board [] Live parts of machine or equipment exposed

ক্যাপ আইটেম ক্যাটাগরি

১০.১. কাৰ্যক্ৰম

Repair broken/loose MCCB/MCB box. Provide duplicate earth leads. Provide earthing to body & door. Provide earth bar/neutral bar lidentify cause of burning inside distribution box কাৰ্যক্ৰম and take remedial measures [] Provide clear identification mark on distribution board. [] Install MDB/SDB/SB or MCB on metal board.

সপারিশের ত্ত্থ্যসূত্র

কারখানার কাৰ্যক্ৰম

We have not taken any action but we will take action and complete within this timeline.

অগ্রাধিকার ৬ সপ্তাহ

চুডান্ড সময়সীমা

52-09-2059

সংশোধিত সমশ্বসীমা

0666-60-60

অগ্রগতির অবস্থা

মন্তব্য

চলমান

Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: No instruction for first aid to electrical shock . Visible burn marks. Connection without lug .Body & door not earthed .No clear identification mark on distribution board .Live parts of machine or equipment exposed. 08-10-2020 No instruction for first aid to electrical shock. Cable ends are soldered. No visible burn marks were found. Connections are with lugs. No undressed messy wire was found inside the panel boards. Body & door are not earthed. Clear identification marks are found on distribution board. No MDB/SDB/SB or MCB installed on the wooden board. No live parts of machine or equipment are exposed. 26-01-2021 on visit day No instruction for first aid to electrical shock .Cable ends not properly soldered or crimped .Visible burn marks. Connection with lug. Body & door not earthed. No clear identification mark on distribution board. 10-06-2021: 1. No broken or loose MCCB/MCB box observed. 2. Duplicate earth leads were not installed. 3. Some distribution boards and its door were not grounded with the earthing system. 4. Earth bar/neutral bar was provided in every distribution boards. 5. No visible burn marks observed in any distribution boards. 6. Clear identification mark observed for the distribution boards. 7. MDB/SDB/SB or MCB were installed on non-combustible material. 07-08-2022 Visit Observation: 1. No broken or loose MCCB/MCB box were observed. 2. Duplicate earth leads were not installed. 3. Some distribution boards and its door were not grounded with the earthing system. 4. Earth bar/neutral bar was provided in every distribution boards. 5. No visible burn marks observed in any distribution boards. 6. Clear identification mark observed for the distribution boards. 7. MDB/SDB/SB or MCB were installed on non-combustible material. 02-04-2023: Same as

সংখুক্তিসমূহ (৪)

previous visit.









No instruction for first aid to electrical shock \(\bigcup \) Cable ends not properly soldered or crimped \(\bigcup \) Visible burn marks \(\bigcup \) Connection without lug \(\bigcup \) Undressed messy wire inside \(\bigcup \) 8 door not earthed \(\bigcup \) No clear identification mark on distribution board \(\bigcup \) MDB/SDB/SB or MCB installed on the wooden board \(\bigcup \) Live parts of machine or equipment exposed

ক্যাপ আইটেম ক্যাটাগরি

১১.১. কার্যক্রম

কাৰ্যক্ৰম	Provide instructions for first aid from exposure to electrical shock Ensure well–dressed cabling with lugs Encase live machine and/or equipment parts
সুপারিশের তথ্যসূত্র	
কারখানার	We have not taken any action but we will take action and complete within this
কাৰ্যক্ৰম	timeline.
<u>অগ্রা</u> ধিকার	প্রব্যোগ্য নর
চুড়ান্ড সমশ্রসীমা	\$\$-09-20\$9
সংশোধিত সময়সীমা	02-02-229
অগ্রগতির অবস্থা	চলমান
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25–06–2020 visit Observation: Undressed messy wire inside. 08–10–2020: No instruction for first aid to electrical shock. Connections are with lugs and No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 10–06–2021: 1. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 2. Cables were well dressed with proper sized lugs. 3. All electrical equipment have proper mechanical guards. 07–08–2022 Visit Observation: 1. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 2. Cables were well dressed with proper sized lugs. 3. All

electrical equipment have proper mechanical guards. 02-04-2023: Same as

সংযুক্তিসমূহ (৪)

previous visit.







১২. পর্ববেষ্ণণ

প্রিদর্শন প্রিদর্শন প্রিদর্শন প্রিদর্শন তিনাল বিষয়েণ তি

ক্যাপ আই(টম ক্যাটাগরি

১২.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	\square Provide electrical service shaft or insulated conduits \square Ensure secured connections with lug \square Replace undressed messy wiring/cables \square Properly solder cable ends
সুপারিশের তখ্যসূত্র	
কার্থানার কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	৬ সপ্তাহ
চুডান্ত সমশ্রসীমা	22-04-5074
সংশোধিত সমশ্বসীমা	07-07-7940
অগ্রগতির অবস্থা	সংশোধিত
ম্ভব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19–Jul–17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25–06–2020 visit Observation: Electric cables do not pass through electrical service shaft or insulated conduits. Connections without lug. Cable ends not properly soldered or crimped. 08–10–2020: Cable ends are soldered. Connections are with lugs. No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 26–01–2021: On visit day Cable ends are soldered. Connections are with lugs. No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 10–06–2021: 1. Electrical cables rises from floor to ceiling through insulated conduits. 2. Cables were secured with proper sized lugs at the termination points of MCCB/MCB. 3. Cables were dressed properly inside the distribution boards. 4. Cable ends were soldered properly. 07–08–2022 Visit Observation: 1. Electrical cables rises from floor to ceiling through insulated conduits. 2. Cables were secured with proper sized lugs at the termination points of MCCB/MCB. 3. Cables were dressed properly inside the distribution boards. 4. Cable ends were soldered properly. 02–04–2023: Same as previous visit.

নঃ previou সংযুক্তিসমূহ (8)









পরিদর্শন পর্শবেষ্ষণ	Lightning protection system not available
ক্যাপ্	
আহ্'ডেম	
ক্যাডাগার	

কাৰ্যক্ৰম	Provide appropriate Lightning protection system.
	Provide appropriate Lightning protection system.
সুপারিশের	
ত্থ্যসূত্র	
কারখানার	We have not taken any action but we will take action and complete within this
কাৰ্যক্ৰম	timeline.
<u>অগ্রা</u> ধিকার	৬ মাস
চুডান্ত সময়সীমা	09-22-2029
সংশোধিত্ত	
अभ्यात्म <u> अ</u>	02-02-2290
<u>অগ্রগতির</u>	চলমাল
অবস্থা	
মন্ত ব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: They are not found Lightning protection system. 08-10-2020: Approved LPS design drawing is found on site. They are willing to work as soon as possible. 26-01-2021 on visit day Approved LPS design drawing is found on site. the factory roof top Lightning protection system is not installed. 10-06-2021: Lightning protection design was found available in the factory but did not install yet. 07-08-2022 Visit Observation: LPS drawing already approved from DIFE but factory not yet installed LPS system. 02-04-2023: Same as previous visit.

সংশুক্তিসমূহ (২)



