

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"শ্রমজীবী মানুষের অধিকার, বৈষম্যহীন বাংলাদেশের অঙ্গীকার"

ক্যাপ পর্ববেষ্ফণের তথ্য

কারখানার নাম	শাবাব ফেব্রিক্স লি:
ঠিকানা	Bashil, Hazirbari, Bhaluka, Mymensingh-2240
কারখানার কোড	MYM004
কালার কোড	

মূল্যায়নের ধরণ: অমি মূল্যায়ন	T	পর্যবেষ্ডণের তারিখ: 🕒
১. পর্যবেষ্ণণ		
	doors in egress route The exit doors in th doors and do not open in the direction of	
১.১. কার্যক্রম		
কাৰ্যক্ৰম type door,	existing exit doors on evacuation routes, which swing outward and in the direction constrict the width of the corridor / passa	of travel. Swinging of the door
সুপারিশের তথ্যসূত্র		
কার্থানার কার্যক্রম		
অগ্রাধিকার ৬ সপ্তাহ		
চূড়ান্ড সমশ্বসীমা		
সংশোধিত সমশ্রসীমা	3	
অগ্রগতির অবস্থা		
have been replaced. C মন্তব্য Shutter typ doors are fo On 15-12-2	2020 (CVV1): Factory has taken action. No replaced but in some places these shutted on 28/09/2020 (CVV2): Factory has been doors from all exit doors at egress rout found at some exits of the factory. Location 2020 (CVV3): Factory has been taken action to be the property of the factory. During the	r type doors have also been en removing work of sliding & e but sliding & Shutter type en: Utility building & Shed-03 tion. Most of the shutter type

২. পর্যবেষ্ণণ

	Location – All doors in egress route The egress route exit doors are sliding, steel sewing & shutter type and there is chance that doors get locked due to any obstruction in opening/closing.
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্যক্ৰম	Remove all locking device from all egress door. All exit doors should be open-able from the side they serve without the use of a key.
সুপারিশের তখ্যসূত্র	
কারখীনার কার্বক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চুডান্ত সময়সীমা	
সংশোধিত সময়সীমা	2.6. − o.p. − ≤ o.≤ ≤
অগ্রগতির অবস্থা	চলমাল
মন্ত ব্য	On 12/02/2020 (CVV1): Factory has taken action. Most of the shutter type doors have been replaced but in some places these shutter type doors have also been replaced. On 28-09-2020 (CVV2): Factory has been removing work of locking arrangements from all exit doors at egress route but Locking features are found at some exits of the factory. Location: Utility building, Shed-03 On 15-12-2020 (CVV3): It has been found same as it was before. Locking features have been found in some places. Location: Utility building, Shed-03

৩. পর্যবেষ্ফণ

পরিদর্শন	Location – All stairs Handrail is not provided on both side of the staircase, only one side
পর্ববেষ্ণণ	is provided.
ক্যাপ	
<u>আইটেম</u>	
ক্যাটাগরি	

.১. কাৰ্যক্ৰ	4
কাৰ্যক্ৰম	Provide handrails on both side of each stairway with height of 0.9m measured from the nose of stair to the top of the handrail.
সুপারিশের	
ভ৾খ্যসুত্ৰ	
<u>কার্থানার</u>	
কাৰ্যক্ৰম	
অগ্রাধিকার	৬ সপ্তাহ
চুডান্ড সময়সীমা	_
সংশোধিত সময়সীমা	\$&-0₽-5055
অগ্রগতির অবস্থা	চলমাল
মন্তব্য	On 12/02/2020 (CVV1): Factory has taken action. Handrail is provided on both side of the staircase in building 01 but both side handrail not provide of unility building. On 28-09-2020 (CVV2): Handrails have been found only on one-side of stairway from ground floor to top floor at 2 storied utility building. On 15-12-2020 (CVV3): It has been found same as it was before. Both side handrail are not found in utility building.

৪. পর্ববেষ্ফণ

পরিদর্শন পর্ববেষ্কণ	Location – All stairs (Building – 01) Sliding, steel sewing type doors are installed, which are without self closing type at evacuation route, so stairs require fire rated self – closing door. However self closing fire door installation process is ongoing.
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্যক্ৰম	Doors in stair should be outward opening, side-swing, self closing, non-lockable 1.5 hours fire rated self closing door in all stair way encloses.
সুপারিশের	
<u>ভ</u> িখ্যসূত্র	
কারখানার	
কাৰ্যক্ৰম	
<u>অগ্রা</u> ধিকার	৬ সপ্তাহ
<u> চুডান্ড</u>	
সময়সীমা	-
সংশো <u>ধ</u> িত	
সমশ্বসীমা	%€-0₽-5055
<u>অগ্রগতির</u>	
অবস্থা	চলমান
মন্ত ব্য	On 12/02/2020(CVV1): Factory has taken action. On 28-09-2020(CVV2): 1) Fire rated side hinged swing type doors are are found at both exit from ground floor to 3th floor at 4 storied building (Production building) 2) The doors are found damaged and also with problematic enclosure. 3) Proper rating and certification documents of the doors are not found in the factory. On 15-12-2020(CVV3): It has been found same as it was before. stair is separated by fire rated construction and installed fire door but not fuctional.

ধ. পর্যবেষ্ণণ

পরিদর্শন পর্শবেষ্ডণ	Location – Stair – 02 (Building – 01) Stair – 02 is finished at ground floor beside fabrics store and finally discharge outside via without fire rated corridor where required fire separated corridor.
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্শক্ৰু	Y
কাৰ্যক্ৰম	Within 6 Weeks, Prepare proper plan and design for fire rated barrier for 2 hours fire rating separated corridor at ground floor or 1.5 hours fire rating door at store.
সুপারিশের তথ্যসূত্র	
কার্থানার কার্যক্রম	
<u>অগ্রা</u> খিকার	৬ সপ্তাহ
চুডান্ত সময়সীমা	-
সংশোধিত সময়সীমা	%€-0B-2022
অগ্রগতির অবস্থা	চলমাল
মন্তব্য	On 12/02/2020(CVV1): Factory has taken action.But Design drawing of can not provided by the factory personel. On 28-09-2020(CVV2): Fire separation design drawing not found in the factory but The factory management has entered into an agreement with BD technology for fire safety work and degain & drawing are submitted to RCC-DIFE On 15-12-2020(CVV3): It has been found same as it was before.

৬. পর্ববেষ্ণণ

পরিদর্শন পর্ববেষ্কণ	Location – Stair – 02 (Building – 01) Stair – 02 is finished at ground floor beside fabrics store and finally discharge outside via without fire rated corridor where required fire separated corridor.
ক্যাপ আইটেম ক্যাটাগরি	

has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated si hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	,			
building, which requires 2 hour fire rated construction at ground floor for fire separated corridor. Or 1.5 hours fire rating door at store. সুপাৰিশেন ভিশাসুত্ৰ কানখনান কাৰ্যক্ৰম আধিকান ৬ মাস টুড়ান্ত সমন্বসীমা সংশোধিত সমন্বসীমা অঞ্চাত্তিন অব্দ্যা তিলাল On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated side hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	৬.১. কাৰ্যক্ৰ	১.১. কাৰ্যক্তম		
কাৰ্থানাৰ কাৰ্যক্তম জ্ঞাধিকাৰ ৬ মাস চূড়ান্ত সমস্ত্ৰসীমা সংশোধিত সমস্ত্ৰসীমা অগ্ৰহণতিৰ অবস্থা On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated sin hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	কাৰ্শক্ৰম	building, which requires 2 hour fire rated construction at ground floor for fire		
কাৰ্যক্ষম জ্ঞাধিকাৰ ৬ মাস চূড়ান্ত সমস্ত্ৰসীমা সংশোধিজ সমস্ত্ৰসীমা ভাগ্ৰাজিৰ অবস্থা On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated side hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	1 ~			
চুড়ান্ত সমস্বসীমা সংশোধিত সমস্বসীমা অগ্রগতিব অবস্থা On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated sit hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the				
সমস্যামা সংশাধিত সমস্যামা অগ্রগতির অবস্থা On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated singled swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	অগ্রাধিকার	৬ মাস		
সময়সীমা ^{৩৪–৩১–২০৩} অগ্রগতির অবস্থা On 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installe has been completed in the building 01. On 28–09–2020(CVV2): 1) Fire rated si hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the		_		
তা 12/02/2020(CVV1): Factory has taken action. Most of the Fire doors installed has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated singled swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the		08-07-505@		
has been completed in the building 01. On 28-09-2020(CVV2): 1) Fire rated si hinged swing type doors are are found at stair 2 (Production building) and not functional. 2) The doors are found damaged and also with problematic enclosure 3) Proper rating and certification documents of the doors are not found in the	1	চলমাল		
floor is separated by fire rated construction from fabrics store and finally dischargoutside and installed fire door but not fuctional.	মন্তব্য	functional. 2) The doors are found damaged and also with problematic enclosure. 3) Proper rating and certification documents of the doors are not found in the factory. On 15–12–2020 (CVV3): It has been found same as it was before. Ground floor is separated by fire rated construction from fabrics store and finally discharge		

৭. পর্ববেষ্ফণ

পরিদর্শন Location – Shed – 03 Gray fabrics store is located at shed – 03 adjacent with fabrics পর্শবেক্ষণ inspection area which is not fire separated. ক্যাপ আইটেম ক্যাটাগরি

৭.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Within 6 Weeks, Prepare proper plan and design for 2 hrs fire rated barrier with 1.5 hrs fire rated door for storage area.
সুপারিশের তখ্যসূত্র	
কারখানার কার্বক্রম	
<u>অগ্রা</u> খিকার	৬ মপ্তাহ
চুডান্ড সমশ্রসীমা	
সংশোধিত সময়সীমা	%€-0₽-2022
অগ্রগতির অবস্থা	চলমাল
মন্তব্য	On 12/02/2020(CVV1): Factory has taken action. But Design drawing of can not provided by the factory persone. On 28-09-2020(CVV2): Fire separation design drawing not found in the factory but The factory management has entered into an agreement with BD technology for fire safety work and degain & drawing are submitted to RCC-DIFE On 15-12-2020(CVV3): It has been found same as it was before.

৮. পর্যবেষ্ণণ

পরিদর্শন Location – Shed – 03 Gray fabrics store is located at shed – 03 adjacent with fabrics পর্যবেষ্কণ inspection area which is not fire separated.
ক্যাপ

আইটেম ক্যাটাগরি

৮.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Within 6 Months, Provide 2 hrs fire rated barrier with 1.5 hrs fire rated door for
	storage area.
সুপারিশের	
<u>ত্থ্যসূত্র</u>	
কার্খানার	
কাৰ্যক্ৰম	
<u> অগ্রাখিকার</u>	৬ মাস
চুডান্ড	
<u> </u>	
সংশ <u>ো</u> ধিত	08-0%-303@
সমশ্বসীমা	08-08-404-9
অ গ্রগতির	চলমান
অবস্থা	
	On 12/02/2020 (CVV1): Factory has taken action. On 28-09-2020 (CVV2): The
মন্তব্য	factory does not use fabric inspection area in the gray fabric store but As per
	approval design drawing the factory need to ensure adequate fire rated
	construction in required occupancies. On 15–12–2020 (CVV3): It has been found
	same as it was before.

ა. ა	১. প্ৰ-(ৰঞ্চণ		
ori	नेजान		
্বা প্র	ন্দাণ ব্বৈষ্ক্রণ	The factory has no provision of periodic checking of fire pump system.	
ক	ПЯ		
অ	ইটেম 		
<u> </u>			

.১. কাৰ্শক্ৰু	
কাৰ্যক্ৰম	Periodically check fire pumps. Maintain record properly
সুপারিশের	
ভ৾খ্যসূত্ৰ	
কার্খানার	
<u>কাৰ্যক্ৰম</u>	
<u>অগ্রাধিকার</u>	প্রব্যোগ্য নয়
চুডান্ড সময়সীমা	_
সংশোধিত সময়সীমা	02-07-7940
অগ্রগতির অবস্থা	চলমান
মন্তব্য	On 12/02/2020 (CVV1): Factory has taken action. On 28-09-2020 (CVV2): Record of testing for fire pump system are found during inspection but fire pump not dedicated fire pump. On 15-12-2020 (CVV3): It has been found same as it was before.