



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোভন কর্মপরিবেশ;
গড়ে তুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্যবেক্ষণের তথ্য


| | |
|---|--|
| কারখানার নাম | ক্রস লাইন ওভেন এ্যাপারেলস লিঃ |
| ঠিকানা | Sharifpur, Haricne (Left side) National University, Gazipur Sadar, Gazipur |
| কারখানার কোড | GZP078 |
| কালার কোড | |
| মূল্যায়নের ধরণ: কাঠামোগত মূল্যায়ন | পর্যবেক্ষণের তারিখ: ৩০-০৫-২০২২ |
| ১. পর্যবেক্ষণ | |

| | |
|---------------------|---|
| পরিদর্শন পর্যবেক্ষণ | Existing structure do not match with Structural Drawing. Corner column dimension is measured 15"x15" on field whereas structural drawing shows 18"x18" corner column. Furthermore, the building have cantilevers on three sides in contrary to the drawing. |
| কাপ আইটেম কাটাগরি | |

১.১. কার্যক্রম

| | |
|----------------------|---|
| কার্যক্রম | Building Engineer to survey column locations and compare with structural drawings. Updated drawings to be prepared showing the correct as constructed layout. |
| সুপারিশের তথ্যসূত্র | |
| কারখানার কার্যক্রম | We will be assign with design and consultant firm and they will complete |
| অগ্রাধিকার | ৬ মাস |
| চূড়ান্ত সমন্বয়সীমা | ০৩-০২-২০১৭ |
| সংশোধিত সমন্বয়সীমা | ০১-০১-১৯৭০ |
| অগ্রগতির অবস্থা | সংশোধিত |
| মন্তব্য | 30.12.2020: They have done retrofitting taking ACCORD/RSC's permission. This NC, incorrect information of having 15"x15" and drawing showing 18"x18" has been corrected. Since they have done retrofitting their column sizes now upgraded to 23"x23" (24"x24" including the plaster) . But they didn't submit the drawings to DIFE. According to ACCORD/RSC, they need to do another soil test and they have done it too but they will receive the test report later. They have done maximum of their work according to ACCORD/RSC standards. 30-05-2022 (CCVV): They have done retrofitting taking ACCORD/RSC's permission. As they are a member of ACCORD/RSC (ID: 10055), they have done DEA, design drawings and also load plans. But they didn't submit any of the documents to DIFE. According to ACCORD/RSC, they need to do another soil test and they have done it too but they will receive the test report later. They have done maximum of their work according to ACCORD/RSC standards. |

সংযুক্তিসমূহ (৪)

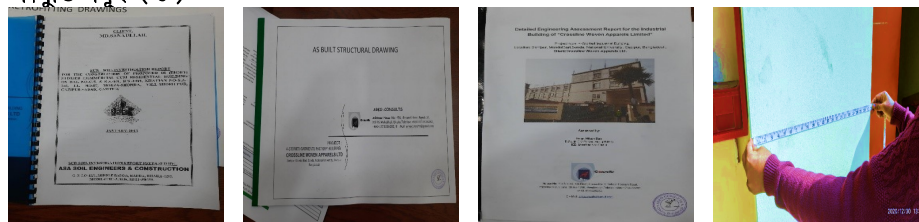

১.২. কার্যক্রম

| | |
|----------------------|---|
| কার্যক্রম | Prepare/update calculations showing the structural adequacy of the floor system taking into account the factory design imposed loading and the as built structure. |
| সুপারিশের তথ্যসূত্র | |
| কারখানার কার্যক্রম | We will be assign with design and consultant firm and they will complete |
| অগ্রাধিকার | |
| চূড়ান্ত সমন্বয়সীমা | ০৩-০২-২০১৭ |
| সংশোধিত সমন্বয়সীমা | ০১-০১-১৯৭০ |
| অগ্রগতির অবস্থা | সংশোধিত |
| মন্তব্য | 30.12.2020: The cantilevers of this building which were not included in the drawings are now included and were found on the as-built structural and architectural drawing. 30-05-2022 (CCVV): They have done retrofitting taking ACCORD/RSC's permission. As they are a member of ACCORD/RSC (ID: 10055), they have done DEA, design drawings and also load plans. But they didn't submit any of the documents to DIFE. According to ACCORD/RSC, they need to do another soil test and they have done it too but they will receive the test report later. They have done maximum of their work according to ACCORD/RSC standards. |

সংযুক্তিসমূহ (৪)

