



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার  
শ্রম ও কর্মসংস্থান মন্ত্রণালয়  
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

সুস্থ শ্রমিক, কর্মঠ হাত আসবে এবার  
নব প্রভাত

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	ওয়েগা অ্যাপারেলস লি:
ঠিকানা	183, Senpara Parbata, Section # 10
কারখানার কোড	DHK628
কালার কোড	
মূল্যায়নের ধরণ: <b>বৈদ্যুতিক মূল্যায়ন</b>	পর্যবেক্ষণের তারিখ: -
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> <li>□ The generator room smaller than the required size</li> <li>□ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door</li> <li>□ No detector in generator room</li> <li>□ No firefighting equipment is present in the generator room</li> <li>□ Combustible materials inside generator room</li> <li>□ One point frame earthing of generator instead of two</li> <li>□ No over current or earth fault protection provided</li> <li>□ No cover on the cable trench</li> </ul>
ক্যাপ আইটেম ক্যাটাগরি	

### ১.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> <li>□ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room.</li> <li>□ Provide firefighting equipment as required by the Guidelines.</li> <li>□ Provide over current and earth fault protection</li> </ul>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	<p>On 29.09.2020: &gt; The generator room is smaller than requirement in size. &gt; There's no fire separation between the generator and the rest of the occupancy. &gt; there's no detector in generator room. &gt; No firefighting equipmnet was available in the generator room. &gt; Combustible materials were present inside the generator room. &gt; Double earthing was not ensured on the generator body. &gt; Over current protection device was present but no earth fault protection was found. &gt; No cover was found on the cable trench. &gt; Factory has not produced fire separation design drawings yet. &gt; Firefighting equipment has not been provided in the generator room. On 11.01.2021: &gt; The generator room is smaller than requirement in size. &gt; There's no fire separation between the generator and the rest of the occupancy. &gt; there's no detector in generator room. &gt; No firefighting equipmnet was available in the generator room. &gt; Combustible materials were present inside the generator room. &gt; Double earthing was not ensured on the generator body. &gt; Over current protection device was present but no earth fault protection was found. &gt; No cover was found on the cable trench. &gt; Factory has not produced fire separation design drawings yet. &gt; Firefighting equipment has not been provided in the generator room. On 13.09.2021: &gt; The generator room is smaller than requirement in size. &gt; There's no fire separation between the generator and the rest of the occupancy. &gt; there's no detector in generator room. &gt; No firefighting equipmnet was available in the generator room. &gt; Combustible materials were present inside the generator room. &gt; Double earthing was not ensured on the generator body. &gt; Over current protection device was present but no earth fault protection was found. &gt; No cover was found on the cable trench. &gt; Factory has not produced fire separation design drawings yet. &gt; Firefighting equipment has not been provided in the generator room.</p>

### ২. পর্যবেক্ষণ

পরিদর্শন পৰ্যবেক্ষণ	<p>□ The generator room smaller than the required size □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cover on the cable trench</p>
ক্যাপ আইটেম ক্যাটাগরি	

### ২.১. কার্যক্রম

কার্যক্রম	<p>□ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room □ Install generator on the ground floor □ Install appropriate detectors.</p>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	<p>On 29.09.2020: &gt; factory hasn't provided fire rated enclosure or door for the generator room. &gt; The generator is installed on the ground floor. &gt; Appropriate detectors have not been installed yet. On 11.01.2021: &gt; factory hasn't provided fire rated enclosure or door for the generator room. &gt; The generator is installed on the ground floor. &gt; Appropriate detectors have not been installed yet. On 13.09.2021: &gt; factory hasn't provided fire rated enclosure or door for the generator room. &gt; The generator is installed on the ground floor. &gt; Appropriate detectors have not been installed yet.</p>

### ৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<p>□ The generator room smaller than the required size □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cover on the cable trench</p>
ক্যাপ আইটেম ক্যাটাগরি	

### ৩.১. কার্যক্রম

কার্যক্রম	<p>□ Remove Combustible materials from generator room. □ Ensure accessibility and ventilation to generator □ Ensure double earthing of generator frame □ Provide cover on the cable trench</p>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: &gt; Combustible materials were present in the generator room. &gt; There's not enough clearance to access the generator. Also enough ventilation has not been ensured. &gt; Double earthing of generator room has not been ensured. &gt; No cover was found on the cable trench. On 11.01.2021: &gt; Combustible materials were present in the generator room. &gt; There's not enough clearance to access the generator. Also enough ventilation has not been ensured. &gt; Double earthing of generator room has not been ensured. &gt; No cover was found on the cable trench. On 13.09.2021: &gt; Combustible materials were present in the generator room. &gt; There's not enough clearance to access the generator. Also enough ventilation has not been ensured. &gt; Double earthing of generator room has not been ensured. &gt; No cover was found on the cable trench.</p>

### ৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> <li>□ Panel door damaged/not present</li> <li>□ No instruction for first aid to electrical shock</li> <li>□ Access obstructed/barred</li> <li>□ Cable ends not properly soldered or crimped</li> <li>□ Visible burn marks</li> <li>□ Connection without lug</li> <li>□ Messy wire inside</li> <li>□ Body &amp; door not earthed</li> <li>□ No clear identification mark on distribution board</li> <li>□ MDB/SDB/SB or MCB installed on the wooden board</li> </ul>
ক্যাপ আইটেম ক্যাটাগরি	

#### ৪.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> <li>□ Repair broken/loose MCCB/MCB box.</li> <li>□ Provide duplicate earth leads.</li> <li>□ Provide earthing to body &amp; door.</li> <li>□ Provide earth bar/neutral bar</li> <li>□ Identify cause of burning inside distribution box and take remedial measures</li> <li>□ Provide clear identification mark on distribution board.</li> <li>□ Install MDB/SDB/SB or MCB on metal board.</li> </ul>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: &gt; broken/loose MCCB boxes have not been repaired. &gt; duplicate earth leads have not been provided. &gt; No earthing was found in panel body and door. &gt; There's no earth bar/neutral bar from 2nd floor to 5th floor. &gt; No clear identification was found on distributin board.</p> <p>On 11.01.2021: &gt; broken/loose MCCB boxes have not been repaired. &gt; duplicate earth leads have not been provided. &gt; No earthing was found in panel body and door. &gt; There's no earth bar/neutral bar from 2nd floor to 5th floor. &gt; No clear identification was found on distributin board.</p> <p>On 13.09.2021: &gt; broken/loose MCCB boxes have not been repaired. &gt; duplicate earth leads have not been provided. &gt; No earthing was found in panel body and door. &gt; There's no earth bar/neutral bar from 2nd floor to 5th floor. &gt; No clear identification was found on distributin board.</p>

#### ৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Electric cables do not pass through electrical service shaft or insulated conduits <input type="checkbox"/> Connections without lug <input type="checkbox"/> Undressed messy wiring/cables <input type="checkbox"/> Cable ends not properly soldered or crimped
ক্যাপ আইটেম ক্যাটাগরি	

#### ৫.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide electrical service shaft or insulated conduits <input type="checkbox"/> Ensure secured connections with lug <input type="checkbox"/> Replace undressed messy wiring/cables <input type="checkbox"/> Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: &gt; electrical service shaft or insulated conduits are not provided. &gt; secured connection with lugs is not ensured. &gt; undressed messy cables have not been replaced. &gt; Cable ends are not properly soldered. On 11.01.2021: &gt; electrical service shaft or insulated conduits are not provided. &gt; secured connection with lugs is not ensured. &gt; undressed messy cables have not been replaced. &gt; Cable ends are not properly soldered. On 13.09.2021: &gt; electrical service shaft or insulated conduits are not provided. &gt; secured connection with lugs is not ensured. &gt; undressed messy cables have not been replaced. &gt; Cable ends are not properly soldered.</p>

#### ৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Lightning protection system not available
কাপ আইটেম ক্যাটাগরি	

#### ৬.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	On 11.01.2021: LPS design submitted to DIFE/RCC, but did not found any copy on site. On 13.09.2021: LPS design submitted to DIFE/RCC, but did not found any copy on site.