

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"শ্রমজীবী মানুষের অধিকার, বৈৰম্যাহীন বাংলাদেশের অঙ্গীকার"

ক্যাপ পর্ববেষ্ফণের তথ্য

কারখানার নাম	ফ্যাশন কম্পোজিট প্রভাক্টম লিঃ
ঠিকানা	SATABDI BHABAN, 2ND & 3RD FLOOR, 19, MAIN ROAD, MIRPUR-10, DHAKA
কারখানার কোড	DHK204
কালার কোড	

মূল্যায়নের গ	ল্যারনের ধরণ: বৈদ্মুতিক মুল্যারন পর্ববেষ্ফণের তারিখ:		
১. পর্যবেষ্ণ	า		
পর্যবেষ্ফণ	The generator room is not properly segregated from presence of non Fire-rated Door I No detector in materials inside generator room I One point frame No over current or earth fault protection provide	e earthing of generator instead of two	
ক্যাপ আইটেম ক্যাটাগরি			
১.১. কাৰ্	১.১. কাৰ্যক্ৰম		

•	Produce design drawings to demonstrate the incorporation of fire rated enclosure
কাৰ্যক্ৰম	from floor to ceiling and an approved fire rated self–closing swing door for the Generator room.
সুপারিশের তথ্যসূত্র	
কার্যথানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
<u> অগ্রাধিকার</u>	৬ সম্ভাহ
চুডান্ত সময়সীমা	08-09-5038
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্ত ব্য	10–02–2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door.Combustible materials inside generator room.One point frame earthing of generator instead of two.No over current or earth fault protection,provided,No cable trench . On 24–05–2021(CVV), 1.The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door. 2.Combustible materials inside generator room. 3.One point frame earthing of generator instead of two. 4.No over current or earth fault protection provided. 5.No cable trench . 6.No appropriate detectors installed for generator room.

পরিদর্শন পর্ববেষ্ডণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door \(\text{No detector in generator room } \text{I Combustible materials inside generator room } \text{I One point frame earthing of generator instead of two } \text{I No over current or earth fault protection provided } \text{I No cable trench}
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্তম	
কাৰ্যক্ৰম	Provide over current and earth fault protection Provide cable trench with cover
সুপারিশের তখ্যসূত্র	
কার্থানার কার্বক্রম	WE have not taken any action yet but it will be completed within timeline
<u>অগ্রা</u> ধিকার	৬ মাস
চুডান্ড সময়সীমা	₹ <i>७</i> -० <i>\</i> -₹०\
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্ৰাণি
মন্তব্য	10–02–2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door.Combustible materials inside generator room.One point frame earthing of generator instead of two.No over current or earth fault protection,provided,No cable trench . On 24–05–2021(CVV), 1.The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door. 2.Combustible materials inside generator room. 3.One point frame earthing of generator instead of two. 4.No over current or earth fault protection provided. 5.No cable trench . 6.No appropriate detectors installed for generator room.

পরিদর্শন পর্ববেষ্ডণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door \(\text{No detector in generator room } \text{I Combustible materials inside generator room } \text{I One point frame earthing of generator instead of two } \text{I No over current or earth fault protection provided } \text{I No cable trench}
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্ৰম	
কাৰ্শক্ৰম	$\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $
সুপারিশের তখ্যসূত্র	
কার্থানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	প্রব্যোগ্য নয়
চুডান্ড সমশ্বসীমা	o b - o b - 2 o 3 b
সংশোধিত সমশ্রসীমা	02-02-2290
অগ্রগতির অবস্থা	শুৰু হ্ৰ্যনি
মন্তব্য	10–02–2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door.Combustible materials inside generator room.One point frame earthing of generator instead of two.No over current or earth fault protection,provided,No cable trench . On 24–05–2021(CVV), 1.The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire–rated Door. 2.Combustible materials inside generator room. 3.One point frame earthing of generator instead of two. 4.No over current or earth fault protection provided. 5.No cable trench . 6.No appropriate detectors installed for generator room.

পরিদর্শন পর্ববেষ্ফণ	Access to substation not easy Ventilation and illumination of substation is poor Separating wall not extended up to the ceiling No clear identification mark on distribution panel No instruction for first aid to electrical shock and artificial respiration Non-conductor mat not provided Electric cables do not pass through insulated conduits Connection without lug
ক্যাপ আইটেম ক্যাটাগরি	

৪.১. কা ৰ্ জম		
· 9. 41 100 a		
কাৰ্যক্ৰম	Provide easy access to the substation Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Substation room. Provide clear identification mark on distribution panel. Ensure secured connections with lug	
সুপারিশের তখ্যসূত্র		
কারখানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline	
অগ্রাধিকার	৬ সপ্তাহ	
চুড়ান্ত সমশ্বসীমা	0 8 - 0 8 - 2 0 3 8	
সংশোধিত সমশ্রসীমা	07-07-790	
অগ্রগতির অবস্থা	শুৰু হ্বনি	
মন্তব্য	10–02–2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration Non–conductor mat not provided. Electric cables do not pass through insulated conduits Connection without lug. On 24–05–2021 (CVV), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration 6. Non–conductor mat not provided. 7. Electric cables do not pass through insulated conduits 8. Connection without lug. 9. Multi looping of wiring observed at circuit breakers within distribution boards 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device	

পরিদর্শন পর্ববেষ্ফণ	Access to substation not easy Ventilation and illumination of substation is poor Separating wall not extended up to the ceiling No clear identification mark on distribution panel No instruction for first aid to electrical shock and artificial respiration Non-conductor mat not provided Electric cables do not pass through insulated conduits Connection without lug
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্যক্ৰম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Substation room. Place substation in ground floor Install appropriate detectors
সুপারিশের তথ্যসূত্র	
কার্থানার কার্বক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	৬ মাস
চুডান্ড সমশ্বসীমা	२७-०ऽ-२०ऽ१
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্তব্য	10–02–2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration Non–conductor mat not provided. Electric cables do not pass through insulated conduits Connection without lug. On 24–05–2021 (CVV), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration 6. Non–conductor mat not provided. 7. Electric cable do not pass through insulated conduits 8. Connection without lug. 9. Multi looping o wiring observed at circuit breakers within distribution boards 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device

পরিদর্শন পর্ববেষ্ডণ	Access to substation not easy Ventilation and illumination of substation is poor Separating wall not extended up to the ceiling No clear identification mark on distribution panel No instruction for first aid to electrical shock and artificial respiration Non-conductor mat not provided Electric cables do not pass through insulated conduits Connection without lug
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্ৰ	1
কাৰ্যক্ৰম	Remove combustible materials from substation. If Ensure accessibility and ventilation to substation if Provide instructions for first aid and artificial respiration from exposure to electrical shock. If Provide cover on the cable trench and rubber mat in front of the panel if Ensure well-dressed cabling with lugs
সুপারিশের ভখ্যসূত্র	
কার্থানার কার্যক্রম	I will be completed within timeline
অগ্রাধিকার	প্রযোগ্য নয়
চুডান্ড সমশ্বসীমা	ob-ob-<0%
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্ৰাণি
মন্তব্য	10–02–2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration Non–conductor mat not provided. Electric cables do not pass through insulated conduits Connection without lug. On 24–05–2021 (CVV), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration 6. Non–conductor mat not provided. 7. Electric cables do not pass through insulated conduits 8. Connection without lug. 9. Multi looping of wiring observed at circuit breakers within distribution boards 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device

পরিদর্শন পর্ববেষ্কণ	No instruction for first aid to electrical shock Cable ends not properly soldered or crimped Connection without lug Messy wire inside Body & door not earthed No clear identification mark on distribution board
ক্যাপ আইটেম ক্যাটাগরি	

৭.১. কাৰ্যক্ৰম	
কাৰ্শক্ৰম	Provide earthing to body & door. Provide clear identification mark on distribution board.
সুপারিশের ভখ্যসূত্র	
কার্খানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
<u> অগ্রা</u> ধিকার	৬ সম্ভাহ
চুডান্ড সমশ্রসীমা	o ⋈ − o ⋈ − ₹ o ⋈ ⋈
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্তব্য	10–02–2021 on visit day No instruction for first aid to electrical shock Cable ends not properly soldered or crimped.Connection without lug. Messy wire inside.Body & door not earthed.No clear entification mark on distribution board. On 24–05–2021(CVV), 1.No instruction for first aid to electrical shock 2.Cable ends not properly soldered or crimped. 3.Cables were not connected with proper sized lugs . 4.Cables wirings were not found well dressed in distribution boards 5.No clear identification mark on distribution board. 6.No grounding for All distribution boards

পরিদর্শন পর্ববেষ্কণ	No instruction for first aid to electrical shock Cable ends not properly soldered or crimped Connection without lug Messy wire inside Body & door not earthed No clear identification mark on distribution board
ক্যাপ আইটেম ক্যাটাগরি	

১. কাৰ্যক্ৰম	
কাৰ্শক্ৰম	Provide instructions for first aid from exposure to electrical shock Ensure well-dressed cabling with lugs
সুপারিশের তখ্যসূত্র	
কার্থানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
<u>অগ্রা</u> ধিকার	প্রযোগ্য নয়
চুডান্ড সময়সীমা	ob-ob-2o%&
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্তব্য	10–02–2021 on visit day No instruction for first aid to electrical shock Cable ends not properly soldered or crimped.Connection without lug. Messy wire inside.Body & door not earthed.No clear entification mark on distribution board. On 24–05–2021(CVV), 1.No instruction for first aid to electrical shock 2.Cable ends not properly soldered or crimped. 3.Cables were not connected with proper sized lugs . 4.Cables wirings were not found well dressed in distribution boards 5.No clear identification mark on distribution boards 6.No grounding for All distribution boards

পরিদর্শন	Electric cables do not pass through insulated conduits Connections without lug
পর্ববেষ্ণণ	Messy wiring 🛘 Cable ends not properly soldered or crimped
ক্যাপ	
<u>আইটেম</u>	
ক্যাটাগরি	

.১. কাৰ্যক্ৰম	
কাৰ্যক্ৰম	Provide service ducts or insulated conduits Ensure secured connections with lug Replace messy wiring Properly solder cable end
সুপারিশের তখ্যসূত্র	
কার্য্থানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
<u>অগ্রা</u> খিকার	৬ সপ্তাহ
চুডান্ড সমশ্রসীমা	0 % - 0 % - 2 0 % %
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্তব্য	10-02-2021 on visit day Electric cables do not pass through insulated conduits Connections without lug Messy wiring. Cable ends not properly soldered or crimped. On 24-05-2021 (CVV), 1. Electric cables do not pass through insulated conduits. 2. Cables were not connected with proper sized lugs. 3. Cables wirings were not found well dressed in distribution boards. 4. Distribution Board not concealed. 5. Electrical cables are not sized according to capacity of circuit breakers

১০. প্রধ্বেক্ষণ	
পরিদর্শন পর্ববেষ্ণ্ডণ	ghtning protection system not available
ক্যাপ আইটেম ক্যাটাগরি	

<u>কাৰ্যক্ৰম</u>	Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কার্য্থানার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
<u>অগ্রা</u> খিকার	৬ মাস
চুডান্ত সময়সীমা	₹ <i>%</i> −0 <i>%</i> −₹0 <i>%</i> 9
সংশোধিত সময়সীমা	02-02-2290
অগ্রগতির অবস্থা	শুৰু হ্ৰাণি
মন্ত ব্য	10-02-2021 on visit day Lightning protection system not obtainable. On 24-05-2021 (CVV), Lightning protection system not obtainable.