



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

সুস্থ শ্রমিক, কর্মঠ হাত আসবে এবার
নব প্রভাত

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	বগুটা এ্যাপারেলস লি:
ঠিকানা	Razzak Tower, Dag # 901, 7/1, Uttara Khan
কারখানার কোড	DHK496
কালার কোড	
মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন	পর্যবেক্ষণের তারিখ: ০৩-০৪-২০২৩
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	Combustible materials inside generator room One point frame earthing of generator instead of two
কাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	Remove Combustible materials from generator room. Ensure double earthing of generator frame
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	31.12.2019 (CVV-1): 1. Combustible materials are found in generator Room. 2. Generator frame earthing (grounding) is not provided at two separate points. 22.03.2020 (CVV-2): 1. Combustible materials are found in generator Room. 2. Generator frame earthing (grounding) is not provided at two separate points. 09.06.2021 (CVV), 1. Combustible materials are found in generator Room. 2. Generator frame earthing (grounding) is not provided at two separate points. 10-08-2021: On visit day Combustible materials are found in generator Room. Generator frame earthing (grounding) is not provided at two separate points. 21-08-2022 : 1. Combustible materials & water found in generator room 2. One point frame earthing of generator instead of two 03-04-2023 : Same as before.

সংযুক্তিসমূহ (৬)



২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	☐ No instruction for first aid to electrical shock ☐ Access obstructed/barred ☐ Cable ends not properly soldered or crimped ☐ Connection without lug ☐ Undressed messy wire inside ☐ Combustible materials near DB
ক্যাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	☐ Provide instructions for first aid from exposure to electrical shock ☐ Remove obstruction to ensure access to MDB/MCB Box ☐ Ensure well-dressed cabling with lugs ☐ Remove combustible materials from DB's nearest zone.
সুপারিশের তথ্যসূত্র	
কার্যক্রমের কার্যক্রম	
অগ্রাধিকার	প্রয়োজ্য নয়
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	31.12.2019 (CVV-1): 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Cable ends not properly soldered or crimped. 4. Connection without lug. 5. Undressed messy wire inside. 6. Combustible materials near DB. 22.03.2020 (CVV-2): 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Cable ends not properly soldered or crimped. 4. Connection without lug. 5. Undressed messy wire inside. 6. Combustible materials near DB. 09.06.2021 (CVV): 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Cable ends not properly soldered or crimped. 4. Connection without lug. 5. Undressed messy wire inside. 6. Combustible materials near DB. 10-08-2021: 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Cable ends not properly soldered or crimped. 4. Connection without lug. 5. Undressed messy wire inside. 6. Combustible materials near DB. 21-08-2022: 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Cable ends not properly soldered or crimped. 4. Connection without lug. 5. Undressed messy wire inside. 6. Combustible materials near DB. 03-04-2023 : Same as before.

সংযুক্তিসমূহ (১০)



পরিদর্শন পর্যবেক্ষণ	□ Cable ends not properly soldered or crimped □ Connection without lug □ Undressed messy wire inside
ক্যাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	□ Ensure secured connections with lug □ Replace undressed messy wiring/cables □ Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	31.12.2019 (CVV-1): 1. Cable ends are not soldered and crimped in distribution boards. 2. Connections without lugs are found in distribution boards. 3. Undress messy wire is found in distribution boards. 22.03.2020 (CVV-2): 1. Cable ends are not soldered and crimped in distribution boards. 2. Connections without lugs are found in distribution boards. 3. Undress messy wire is found in distribution boards. 09.06.2021 (CVV): 1. Cable ends are not soldered and crimped in distribution boards. 2. Connections without lugs are found in distribution boards. 3. Undress messy wire is found in distribution boards. 10-08-2021: 1. Cable ends are not soldered and crimped in distribution boards. 2. Connections without lugs are found in distribution boards. 3. Undress messy wire is found in distribution boards. 21-08-2022: 1. Cable ends are not soldered and crimped in distribution boards. 2. Connections without lugs are found in distribution boards. 3. Undress messy wire is found in distribution boards. 03-04-2023: Same as before.

সংযুক্তিসমূহ (১০)



৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	☐ Lightning protection system not available
কাপ আইটেম কাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	☐ Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	31.12.2019 (CVV-1): Proposed lightning protection system drawing is submitted to DIFE for approval on 26.09.2018 but not installed yet. 22.03.2020 (CVV-2): Proposed lightning protection system drawing is submitted to DIFE for approval on 26.09.2018 but not installed yet. 09.06.2021 (CVV): Lightning protection system (LPS) is not installed at building roof top. Factory has submitted the LPS design to DIFE office for approval on 26th September, 2018. 10-08-2021: On visit day Lightning protection system (LPS) is not installed at building roof top. Factory has submitted the LPS design to DIFE office for approval on 26th September, 2018. 21-08-2022 : Lightning protection system not available but Factory has submitted the LPS design to DIFE office for approval. 03-04-2023 : Same as before.

সংযুক্তিসমূহ (২)

